

## **1 PCM-022, phyCORE-PXA255 Errata (PCB# 1219.3)**

- Pin assignment error on the phyCORE-PXA255 at Molex connector X3.
  - The NSSP\_SFRM signal is routed to pin 15C at Molex connector X3 instead of pin 13C.
  - The NSSP\_TXD signal is routed to pin 13C at Molex connector X3 instead of pin 15C.
  - The NSSP\_RXD signal is routed to pin 15C at Molex connector X3 instead of pin 16C.
  
- CAN Interface

The CAN interface on the phyCORE module can only be used in conjunction with the SSP interface provided by the PXA255 controller. It is not possible to use the NSSP interface

## **2 PCM-990, phyCORE-PXA255 Development Board Errata (PCB# 1220.1)**

- Pin assignment error on the Development Board at Molex connectors X17 and X18.
  - The NSSP\_SFRM signal is routed to pin 15C at connector X17 and X18 instead of pin 13C.
  - The NSSP\_TXD signal is routed to pin 13C at connector X17 and X18 instead of pin 15C.
  - The NSSP\_RXD signal is routed to pin 15C at connector X17 and X18 instead of pin 16C.